THIS DRAWING AND DESIGN HEREDIN CONSTITUTES A PROPRIETARY DESIGN OF
MA HELECTRIC PARRICATORS AND IS NOT
TO BE DUPLICATED OR REPRODUCED
WITHOUT AUTHORITY OF MA HELECTRIC.


DO NOT SCALE


FROM THE FACTORY, THE FULL SIZE CHEVY REAR LAMP HARNESSES HAD TWO DIFFERENT WIRE INDEXING CONFIGURATIONS ON THE MAIN CONNECTOR, SHOWN BELOW. NOTE THAT THE ONLY DIFFERENCE IS THAT THE WIRE COLOR INDEXING IS 180 DEGREES OFF ON ONE VERSION VERSUS THE OTHER.

IF YOU DO NOT HAVE AN EXISTING ORIGNAL HARNESS TO COMPARE TO, \*\*\* STOP \*\*\* DO NOT INSTALL THIS HARNESS. FIRST, CALL OUR TECH SUPPORT LINE AT 562-926-9552 FOR FURTHER GUIDANCE FROM OUR TECHNICAL ADVISORS. FAILURE TO DO SO COULD LEAD TO DAMAGE OF THE CAR.

IF YOU ARE UNABLE TO DETERMINE THAT THE OLD REAR LAMP HARNESS WAS WHAT WAS INSTALLED IN THE CAR FROM CHEVROLET, THE ORIGINAL HARNESS WAS DAMAGED TO THE POINT OF NOT BEING ABLE TO DETERMINE THE ORIGINAL WIRING INDEXING OR THE INDEXING LOOKS LIKE IT HAS BEEN CHANGED FOR WHATEVER REASON, \*\*\* STOP \*\*\* DO NOT INSTALL THIS HARNESS, FIRST, CALL OUR TECH SUPPORT LINE AT 562-926-9552 FOR FURTHER GUIDANCE FROM OUR TECHNICAL ADVISERS.

IF THE ORIGNAL HARNESS LOOKS TO BE INTACT AT THE CONNECTOR AND DOES NOT FALL UNDER THE PREVIOUS CATEGORIES, PROCEED TO THE DIRECTIONS BELOW USING YOUR ORIGINAL HARNESS TO DETERMINE THE CORRECT INDEXING.

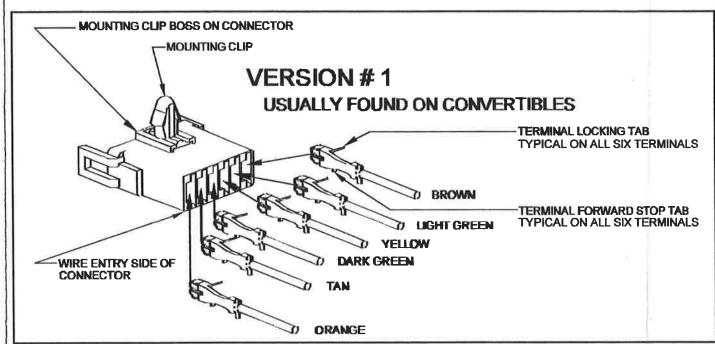

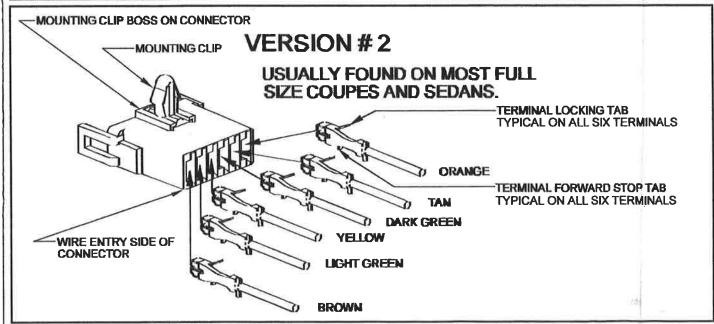

ARRANGE CONNECTOR WITH MOUNTING
 CLIP FACING UP, SO THAT YOU ARE VIEWING

THE WIRE ENTRY SIDE OF THE NEW

CONNECTOR.

2. AS EACH TERMINAL WIRE IS INSERTED, BE SURE NOT TO CONFUSE THE LOCKING TAB WITH THE FORWARD STOP TAB OF THE TERMINAL.

92969316

100 113 349

REVISION RECORD

12-03-10 A ADDED TO 1967 CHEVY REAR

LAMP HARNESS

- 3. INSERT EACH WIRE INTO THE CONNECTOR AS ILLUSTRATED TO THE LEFT.
- 4. LISTEN AND FEEL FOR THE CLICK AS EACH TERMINAL IS INSERTED INTO THE CONNECTOR CAVITY. GENTLY TUG ON THE WIRE WHEN THE CLICK IS HEARD TO BE SURE THE TERMINAL IS FULLY LOCKED IN PLACE.
- 5. ONCE ALL TERMINALS ARE LOCKED INTO THE CONNECTOR CORRECTLY, COMPARE THE NEW HARNESS CONNECTION TO THE EXISTING ONE. THESE SHOULD NOW BE IDENTICAL. NOW THE INSTALLATION OF THE REAR LAMP HARNESS CAN BE COMPLETED.

CODE NO. 6900			
DWG. DATE	NONE	OR. 113	
12-03-10		ск. 349	OATE 12-03-11
REFERENCE NO.		APPR. 100	DATE 12-03-10
		APPR.	DATE 12-03-1
	RUCTION REA	ON SHEET- OR LAMP HA	
PART NO. 92	296	3931	6 B